# HERMACH ENGELHARD TRANSFER VOLTAMMETER

# INSTRUCTION MANUAL


**CHARLES ENGELHARD, INC.**

850 Passaic Avenue, East Newark, New Jersey, U. S. A.

New York Cleveland Chicago Detroit Los Angeles San Francisco
France Japan So. Africa Denmark Switzerland Brazil

Jack Jones
Pleasant 8-1098

# HERMACH ENGELHARD TRANSFER VOLTAMMETER

SERIAL #_____

## INSTRUCTION MANUAL

CHARLES ENGELHARD, INC.

850 PASSAIC AVE.

EAST NEWARK, N. J.

(P.O. HARRISON, N.J.)

## TABLE OF CONTENTS


PAGE

SAFETY PRECAUTIONS ..... 1

METER SPECIFICATIONS ..... 1

GENERAL DESCRIPTION ..... 1

FUNCTIONS OF CONTROLS ..... 5

OPERATION ..... 7

AVAILABLE ACCESSORIES ..... 10

REPLACEMENT PARTS ..... 11

REPLACEMENT INSTRUCTIONS ..... 11


## TABLE OF ILLUSTRATIONS


PAGE

THERMAL CONVERTER (FIG. 1) ..... 2

VOLTAGE MEASUREMENT (FIG. 2A) ..... 3

CURRENT MEASUREMENT (FIG. 2B) ..... 4

CONTROL DESIGNATIONS (FIG. 3) ..... 6

TYPICAL MEASURING CIRCUITS (FIGS. 4A AND 4B) ..... 8

THERMAL CONVERTER (
(
MERCURY PACK ( REPLACEMENT (FIG. 5) ..... 12
(
LAMP BATTERY (

BASIC SCHEMATIC DIAGRAM (FIG. 6) ..... 13

ACCESSORIES (FIG. 7 & 8) ..... 14

## SAFETY PRECAUTIONS

THIS INSTRUMENT, WITH EXTERNAL ACCESSORIES, CAN BE OPERATED AT POTENTIALS WHICH ARE HAZARDOUS. THE OPERATOR SHOULD OBSERVE THE PROPER PRECAUTIONS, BOTH FOR PERSONAL SAFETY AND PROTECTION OF EQUIPMENT.

THE METAL INPUT TERMINAL MARKED "G" IS CONNECTED TO THE INTERNAL SHIELD AND SHOULD ALWAYS BE GROUNDED.

"SINCE THE THERMAL CONVERTER CAN BE DAMAGED BY OVERLOADING, THE SELECTOR SWITCH SHOULD BE IN THE RECTIFIER INSTRUMENT POSITION UNTIL THE RANGE SWITCH SETTING HAS BEEN DETERMINED. THE SELECTOR SWITCH SHALL BE KEPT IN THE #2 POSITION BETWEEN READINGS."

CAUTION

THE MAXIMUM CURRENT THAT CAN BE APPLIED TO THE THERMAL CONVERTER FILAMENT IS 7 MA. CARE SHOULD BE TAKEN NOT TO EXCEED THIS VALUE WHEN CHECKING CONTINUITY OF SAME.

## METER SPECIFICATIONS

FREQUENCY RANGE 20 TO 20,000 CPS.

ACCURACY ± .05% OF FULL SCALE ON ANY RANGE

| RANGE | IMPEDANCE | |
|---|---|---|
| 15 V | 2,000 OHMS | |
| 30 V | 4,000 OHMS | |
| 75 V | 10,000 OHMS | ALL RANGES 133 OHMS PER VOLT |
| 150 V | 20,000 OHMS | |
| 300 V | 40,000 OHMS | |
| 5 A | 0.1 OHMS | |
| 2.5A | 0.2 OHMS | |
| 1.0A | 0.5 OHMS | ALL RANGES 0.5 VOLTS DROP AT RATED |
| 500 MA | 1.0 OHMS | CURRENT |
| 250 MA | 2.0 OHMS | |
| 100 MA | 5.0 OHMS | |

## GENERAL DESCRIPTION

THE HERMACH-ENGELHARD TRANSFER INSTRUMENT IS A PRECISION A-C MULTI-RANGE UNIT WITH AN ACCURACY OF 1/20 OF 1% (.05%) THROUGH A FREQUENCY RANGE FROM 20 TO 20,000 CPS. IT EMPLOYS THE TRANSFER TECHNIQUE WHICH HAS BEEN ESTABLISHED AS STANDARD PROCEDURE IN MAKING HIGH PRECISION A-C MEASUREMENTS. IT DOES NOT REQUIRE A D-C SOURCE IDENTICAL TO THE RMS A-C MEASURED. THE CIRCUIT DESIGN ENABLES POWER FROM A SMALL BATTERY TO MATCH A LARGE VALUE OF ALTERNATING CURRENT OR VOLTAGE. THE VOLTAGE DROP IN A PORTION OF THE D-C CIRCUIT IS MEASURED WITH A POTENTIOMETER. THIS POTENTIOMETER READING IS MULTIPLIED BY APPROPRIATE FACTORS, CONVENIENTLY LOCATED ON THE RANGE SWITCH TO PROVIDE THE RMS A-C MEASUREMENT

BASICALLY, THE CIRCUIT CONSISTS OF A THERMAL CONVERTER, (FIG. 1), WHICH IS SHUNTED TO OBTAIN SEVERAL CURRENT RANGES, OR USED IN SERIES WITH APPROPRIATE RESISTORS TO OBTAIN VOLTAGE RANGES, (AT 133 OHMS PER VOLT)

AS SHOWN, (FIGS. 2A AND 2B) THE HEATER OF THE THERMAL CONVERTER IS SWITCHED IN SERIES WITH APPROPRIATE RESISTORS, OR IN PARALLEL WITH CURRENT SHUNTS. THE RESULTING EMF OF THE THERMAL CONVERTER IS BALANCED BY AN ADJUSTABLE INTERNAL D-C CIRCUIT AS INDICATED BY THE BUILT IN GALVANOMETER. THE HEATER IS SWITCHED TO AN INTERNAL VARIABLE D-C SOURCE WHICH IS ADJUSTED TO GIVE THE SAME THERMAL CONVERTER EMF AND, THEREFORE, THE SAME HEATER CURRENT AS THE A-C SOURCE. THE VOLTAGE ACROSS A PORTION OF THIS CIRCUIT IS MEASURED WITH AN EXTERNAL POTENTIOMETER. THE MEASURED POTENTIAL IS MULTIPLIED BY A SIMPLE FACTOR TO OBTAIN THE UNKNOWN VOLTAGE OR CURRENT. THIS METHOD OF EQUALIZING THE D-C PRODUCED TEMPERATURE AND THE A-C PRODUCED TEMPERATURE ELIMINATES THE THERMAL EFFICIENCY FACTOR OF THE CONVERTER, EXCEPT THAT IT MUST BE STABLE FOR AT LEAST THE DURATION OF THE READING AND THE OUTPUT MUST BE GREAT ENOUGH TO OBTAIN THE REQUIRED SENSITIVITY.

THE VOLTAGE MEASUREMENT FORMULA IS GIVEN IN FIG. 2A. PLEASE NOTE THAT THE MEASURED A-C VOLTAGE DEPENDS ONLY ON THE PRODUCT OF THE POTENTIOMETER READING AND THE RATIO OF THE RESISTANCE ($R_V$ AND $R_S$). $R_V$ INCLUDES RHEATER AND, THEREFORE, MUST BE AT LEAST 2,000 OHMS IN ORDER TO MAINTAIN THE ACCURACY.

THE CURRENT MEASUREMENT FORMULA IS GIVEN IN FIG. 2B. THE VALUE OF THE MEASURED CURRENT IS SIMPLY THE POTENTIOMETER READING, DIVIDED BY THE RESISTANCE OF THE FOUR TERMINAL SHUNT AND IS INDEPENDENT OF THE CONVERTER TEMPERATURE VS. RESISTANCE CHARACTERISTIC. THIS IS ANOTHER REASON WHY THIS INSTRUMENT IS CAPABLE OF HIGH ACCURACY.

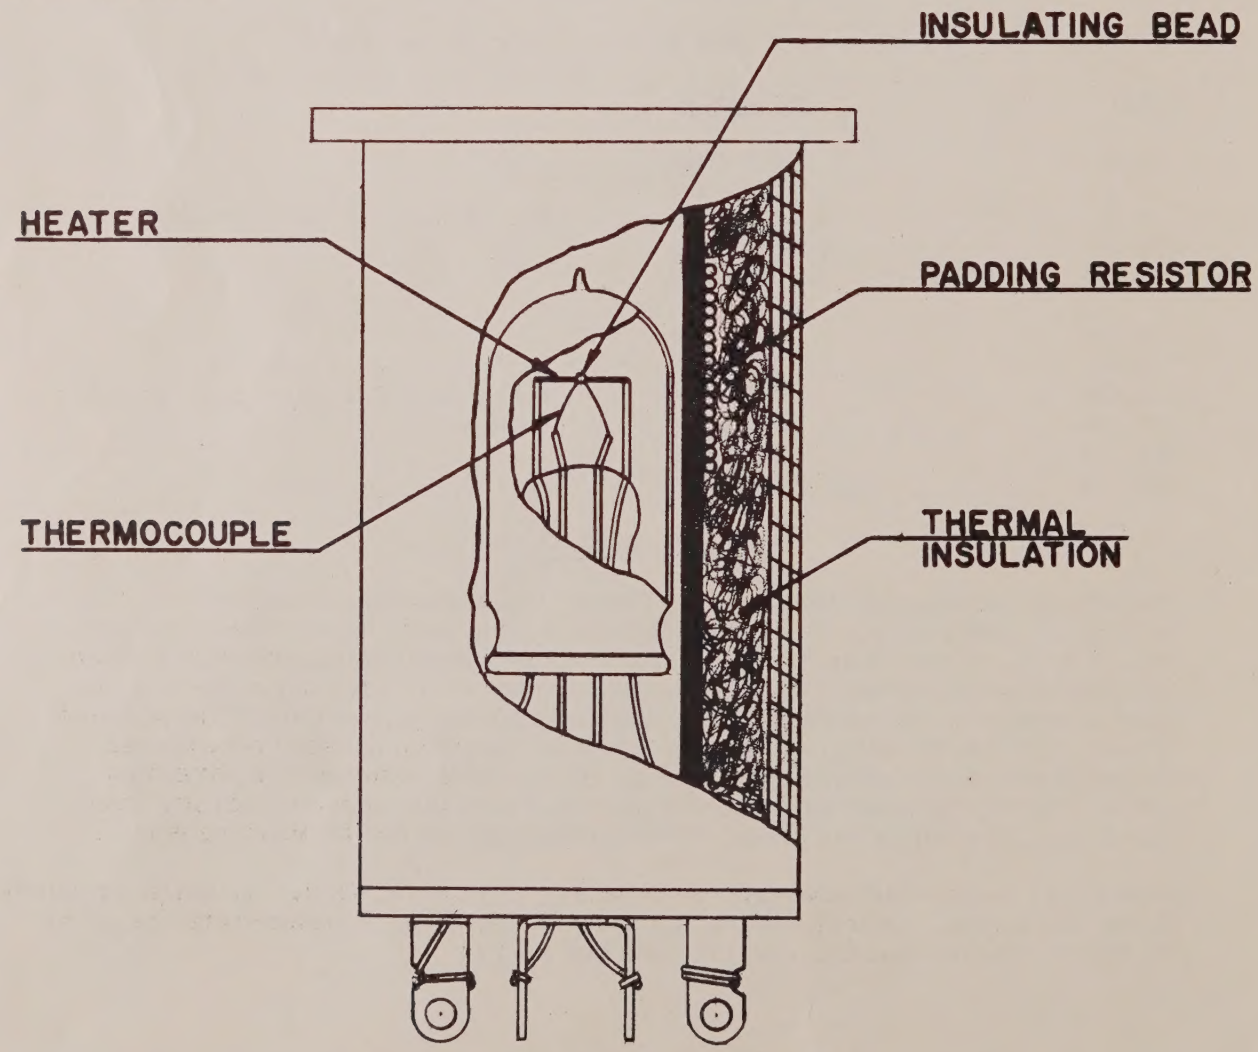


FIG. 1 THERMAL CONVERTER

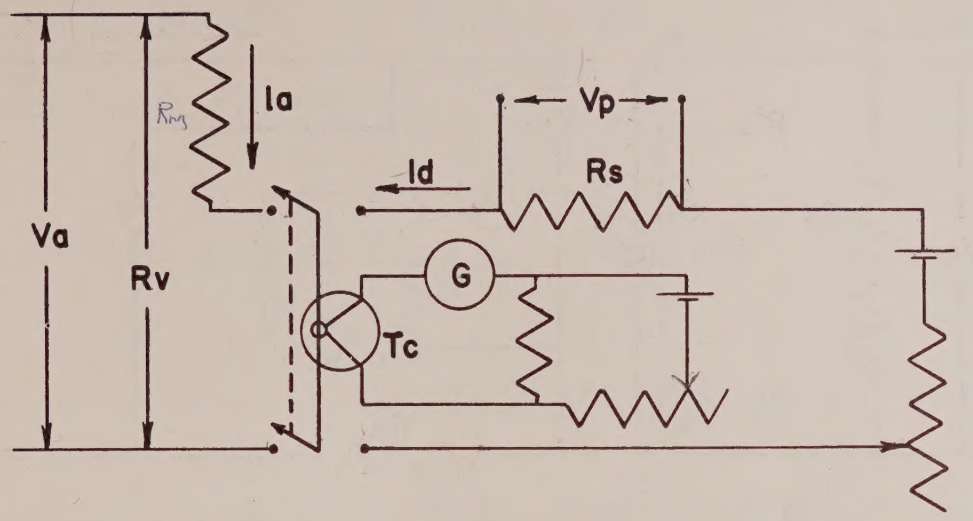


VOLTAGE MEASUREMENT FIG. 2 A

AC VOLTAGE ($V_A$) = AC CURRENT ($I_A$) X METER RESISTANCE ($R_V$) — OHM'S LAW

BUT AC CURRENT ($I_A$) = DC CURRENT ($I_D$) — MATCHED THROUGH THERMAL CONVERTER TO SAME REFERENCE.

THEREFORE
AC VOLTAGE = DC CURRENT X METER RESISTANCE — SUBSTITUTION

BUT
$$\text{DC CURRENT } (I_D) = \frac{\text{DC VOLTAGE } (V_P)}{\text{RESISTANCE } (R_S)}$$
VOLTAGE ($V_P$) IS MEASURED BY POTENTIOMETER ACROSS PRECISION RESISTOR ($R_S$).

THEREFORE
$$\text{AC VOLTAGE } (V_A) = \frac{\text{DC VOLTAGE } (V_P)}{\text{RESISTANCE } (R_S)} \times \text{METER RESISTANCE } (R_V)$$ — SUBSTITUTION

OR
$$\text{AC VOLTAGE} = \text{DC VOLTAGE } (V_P) \times \frac{\text{METER RESISTANCE } (R_V)}{\text{RESISTANCE } (R_S)}$$

WHERE
DC VOLTAGE ($V_P$) IS MEASURED BY POTENTIOMETER

$$\frac{\text{METER RESISTANCE } (R_V)}{\text{RESISTANCE } (R_S)}$$ IS THE METER FACTOR FOR EACH VOLTAGE RANGE

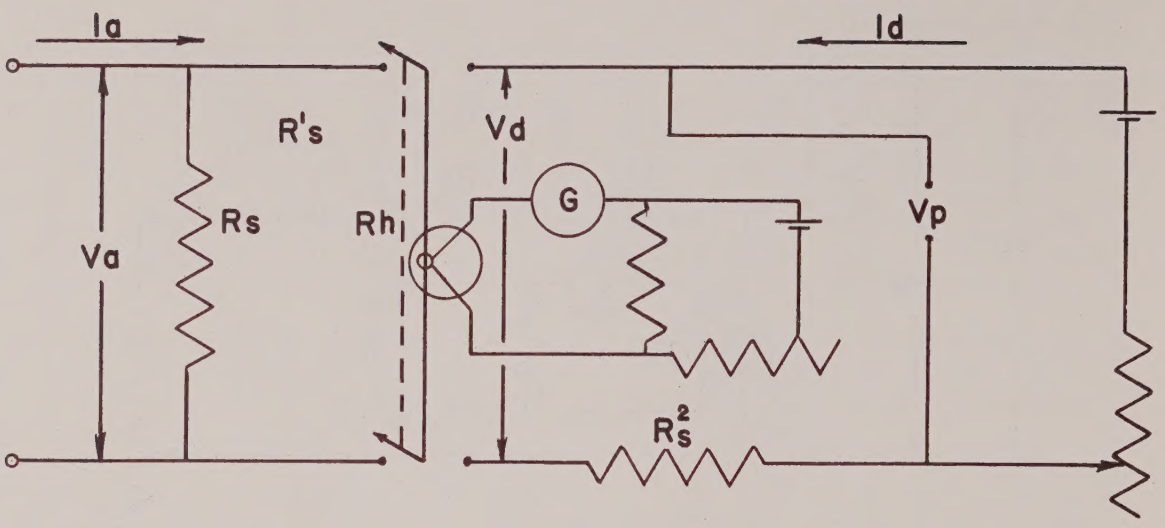


CURRENT MEASUREMENT FIG. 2 B

AC CURRENT ($I_A$) = $\frac{\text{AC VOLTAGE } (V_A)}{\text{METER RESISTANCE } (R'_S)}$ — OHM'S LAW

BUT
METER RESISTANCE ($R'_S$) = $\frac{\text{HEATER RESISTANCE } (R_H) \times \text{SHUNT RESISTANCE } (R_S)}{\text{HEATER RESISTANCE } (R_H) + \text{SHUNT RESISTANCE } (R_S)}$ — FORMULA FOR TOTAL RESISTANCE OF TWO RESISTORS IN PARALLEL.

AC CURRENT ($I_A$) = $\frac{\text{AC VOLTAGE } (V_A)}{\frac{\text{HEATER RESISTANCE } (R_H) \times \text{SHUNT RESISTANCE } (R_S)}{\text{HEATER RESISTANCE } (R_H) + \text{SHUNT RESISTANCE } (R_S)}}$ — SUBSTITUTION

AC CURRENT ($I_A$) = AC VOLTAGE ($V_A$) $\times \frac{(R_H) \quad (R_S)}{\text{HEATER RES.} + \text{SHUNT RES.}}{\text{HEATER RES.} \times \text{SHUNT RES.}}$ — SIMPLIFIED

BUT
AC VOLTAGE ($V_A$) = DC VOLTAGE ($V_D$)

DC VOLTAGE ($V_D$) = DC CURRENT ($I_D$) X HEATER RESISTANCE ($R_H$) — MATCHED THROUGH THERMAL CONVERTER TO SAME REFERENCE

THEREFORE
AC VOLTAGE ($V_A$) = DC CURRENT ($I_D$) X HEATER RESISTANCE ($R_H$) — SUBSTITUTION

BUT
DC CURRENT ($I_D$) = $\frac{\text{DC VOLTAGE } (V_P)}{\text{HEATER RESISTANCE } (R_H) + \text{SERIES RESISTANCE } (R^2_S)}$ — OHM'S LAW $V_P$ = POTENTIOMETER READING

SERIES RESISTANCE ($R^2_S$) = SHUNT RESISTANCE ($R_S$) — BY DESIGN

THEREFORE

$$\text{DC CURRENT } (I_D) = \frac{\text{DC VOLTAGE } (V_P)}{\underset{(R_H)}{\text{HEATER RESISTANCE}} + \underset{(R_S)}{\text{SHUNT RESISTANCE}}}$$ — SUBSTITUTION

$$\text{AC VOLTAGE } (V_A) = \frac{\text{DC VOLTAGE } (V_P)}{\underset{(R_H)}{\text{HEATER RES.}} + \underset{(R_S)}{\text{SHUNT RES.}}} \times \underset{(R_H)}{\text{HEATER RES.}}$$ — SUBSTITUTION FROM PREVIOUS FORMULA

BUT

$$\text{AC CURRENT } (I_A) = \text{AC VOLTAGE } (V_A) \times \frac{\text{HEATER RES. + SHUNT RES.}}{\text{HEATER RES. X SHUNT RES.}}$$ — PREVIOUSLY DETERMINED

$$\text{AC CURRENT } (I_A) = \frac{(V_P) \quad \cancel{(R_H)} \quad \cancel{(R_H)} \quad \cancel{(R_S)}}{\text{DC VOLTAGE X } \cancel{\text{HEATER RES.}} \times \cancel{\text{HEATER RES. + SHUNT RES.}}} \times \frac{}{\cancel{\text{HEATER RES.}} \times \cancel{\text{HEATER RES. + SHUNT RES.}}}$$

$$\cancel{(R_H)} \quad \cancel{(R_S)} \quad \cancel{(R_H)} \quad (R_S)$$

$$\cancel{\text{HEATER RES.}} \times \text{SHUNT RES.}$$ — SUBSTITUTION AND SIMPLIFY

THEREFORE

$$\text{AC CURRENT } (I_A) = \frac{\text{DC VOLTAGE } (V_P)}{\text{SHUNT RES. } (R_S)}$$

OR

$$\text{AC CURRENT} = \text{DC VOLTAGE} \times \frac{1}{\text{SHUNT RES.}}$$

THE DC VOLTAGE IS MEASURED BY THE POTENTIOMETER AND THE RECIPROCAL OF THE SHUNT RESISTANCE IS THE METER FACTOR FOR EACH CURRENT RANGE.

## FUNCTIONS OF CONTROLS (FIG. 3)

1. POTENTIOMETER TERMINALS - FIVE WAY BINDING POSTS; POTENTIOMETER LEADS (SHIELDED) CONNECT TO THESE TERMINALS.

2. POWER SWITCH - TURNS ON REFERENCE D-C, METERED D-C CIRCUITS, AND GALVANOMETER LAMP.

3. PANEL METER - RECTIFIER TYPE METER - DETERMINES OPTIMUM SETTING OF RANGE SWITCH, GIVES INITIAL POTENTIOMETER DIAL SETTING AND ALSO ACTS AS A PROTECTIVE CHECK DEVICE TO MINIMIZE THERMAL CONVERTER DAMAGE.

4. SELECTOR SWITCH - SELECTS FUNCTIONS OF INTERNAL METER CIRCUITS.

5. INSTRUCTION PLATE - CONTAINS CONDENSED OPERATING INSTRUCTIONS AND IS ALSO A COVER PLATE OVER THE THERMAL CONVERTER, MERCURY CELL PACK AND LAMP BATTERY, ALLOWING EASY ACCESS TO THESE ITEMS.

6. FINE CONTROL, METERED D-C - MAKES FINAL ADJUSTMENT OF METERED CURRENT. USED WITH OPTICAL GALVANOMETER INDICATOR. (POSITION 2 OF SELECTOR SWITCH)

FIG. 3 CONTROL DESIGNATIONS

7. Coarse Control, Metered D-C - Used to initially adjust the metered current. Indicated by the galvanometer pointer. (Position 2 of Selector Switch)

8. Fine control, reference D-C - Final adjustment of reference current. Optical indicator. (Position 1 of Selector Switch)

9. Galvanometer switch - three position spring action switch; normally shorts galvanometer. "LO" position shunts the galvanometer and "HI" position gives maximum sensitivity.

10. Galvanometer indicator, optical - light beam indicator used with "HI" sensitivity position of switch and fine controls.

11. Coarse control, reference D-C - Initial adjustment of reference current. (Position 1 of Selector Switch)

12. Galvanometer Zero Adjuster - mechanical control of galvanometer zero current position.

13. Galvanometer indicator, pointer - mechanical indicator has one twelfth (1/12) sensitivity of optical indicator.

14. External Shunt Terminal - provided for accessories. Applies signal directly to Thermal Converter when range switch is in external shunt position.

15. Ground Terminal - input connection. Also meter shield connection. Must be grounded externally.

16. Input terminal - signal is carried to range selector switch from this terminal.

17. Range Switch - selects operating range and type of measurement (voltage or current) to be made.

## OPERATION

(A) AS A MEASURING INSTRUMENT.

Connections to transfer instrument should be made according to Fig. 4A or B.

Before applying the A-C power, the selector switch should be placed in the rectifier instrument position and the range switch should be at the maximum range of voltage or current, whichever is to be measured. Connect a potentiometer having a range of 1.5 volts and an accuracy of 0.015% to the potentiometer terminals (matching polarity markings). Then apply the A-C to be measured to the input terminals. Terminal "G" is connected to the internal shield and should be grounded.

Use the rectifier type panel meter to obtain the correct range: this will prevent the thermal converter from being overloaded. Accurate results will be obtained only with a range setting that gives a meter reading on the upper portion of the scale. Rotate the selector switch to the #1 position and balance the galvanometer with the #1 controls (coarse and fine, 11 and 8 of Fig. 3). This balances the emf developed by the converter. Use the "coarse" control in conjunction with the "LO" position of the galvanometer sensitivity switch and the "fine" control with the "HI" sensitivity position.

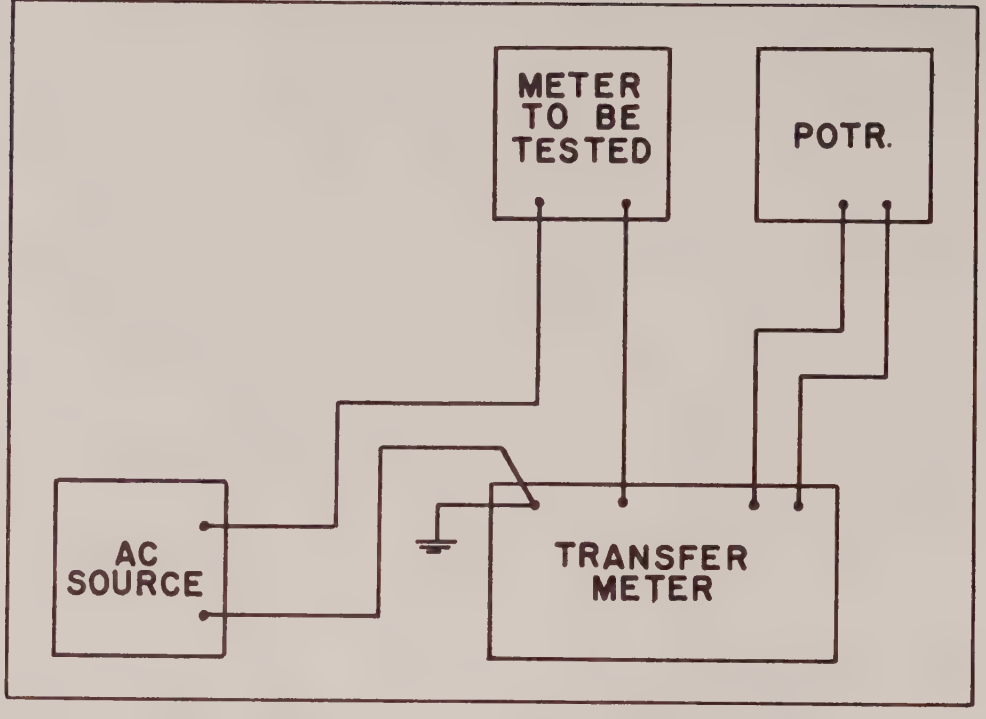


FIG. 4A TYPICAL CIRCUIT FOR CURRENT METER CALIBRATION

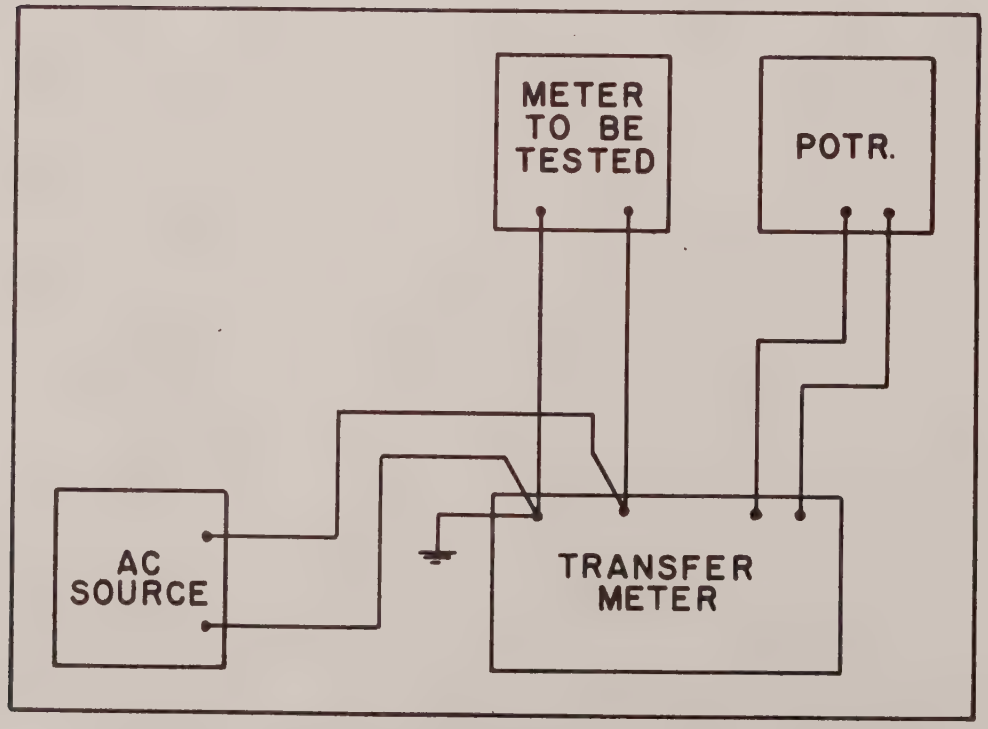


FIG. 4B TYPICAL CIRCUIT FOR VOLTMETER CALIBRATION

300 Ω

1Ω 1Ω 1Ω 1Ω 1Ω

BLACK

VIOLET

BROWN

BLACK
RED

BLUE

WHITE

GRAY

ORANGE

YELLOW

100 Ω POT
30007

10Ω

10

.5Ω

11

.25Ω

30222

0

.1Ω

30009

2

3

4

5

6

YELLOW

WHITE / GREEN

THERMAL CONVERTER
30023

TC - DC
NO 1

WHITE

RED

RECT
INST

11

TC - DC
NO 2

10

TC - DC
CAL
NO 3

9

1

10K

6K

2K

2K

30250

5.5K
30129

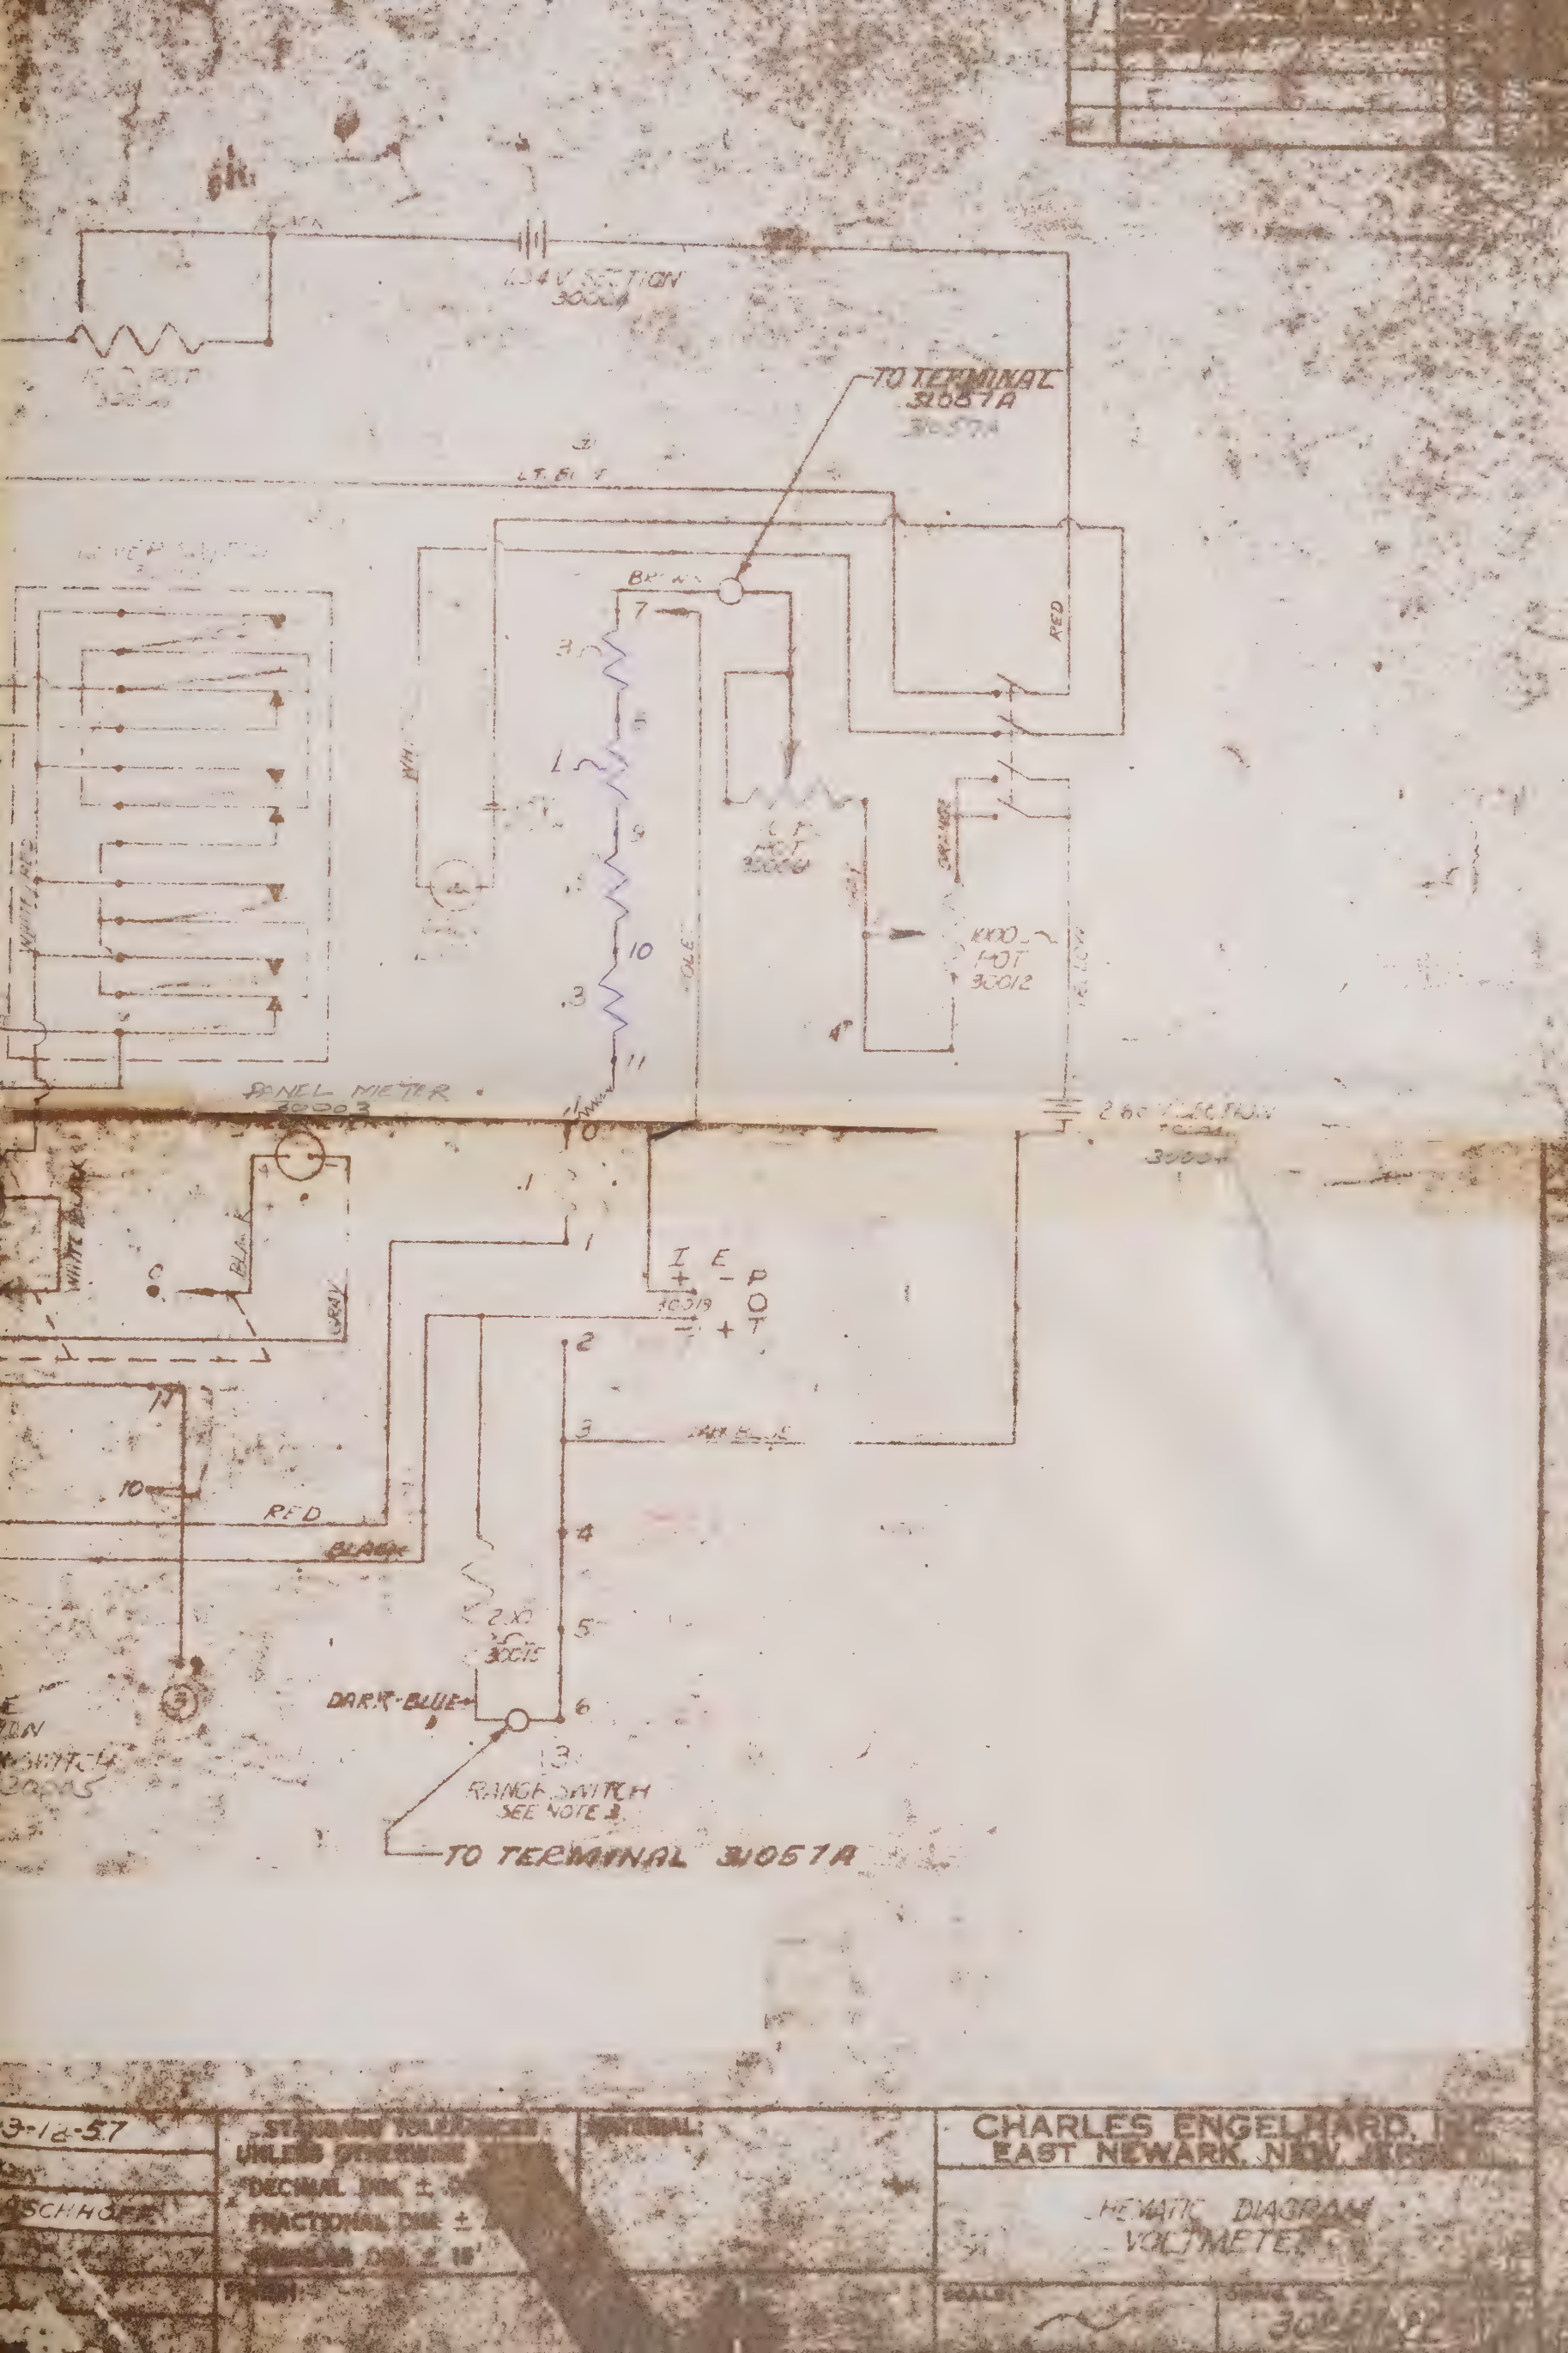


3-12-57

CHARLES ENGELHARD, INC.
EAST NEWARK, NEW JERSEY

PNEUMATIC DIAGRAM
VOLTMETER

SCALE:

DRAWING NO. 30012

CHANGE SELECTOR SWITCH TO THE #2 POSITION AND REBALANCE THE GALVANOMETER WITH #2 CONTROLS (7 AND 6 OF FIG. 3) IN THE SAME MANNER AS WITH THE #1 CONTROLS. THIS EQUILIBRATES THE AVERAGE D-C AND RMS A-C VALUES.

WHEN THIS BALANCE IS ACHIEVED, THE POTENTIOMETER READING SHOULD BE MULTIPLIED BY THE FACTOR INDICATED ON THE RANGE SWITCH TO OBTAIN ACTUAL VALUES. THE SCALE OF THE PANEL METER IS CALIBRATED IN TERMS OF THE POTENTIOMETER READING (WITHIN 5%) AND INDICATES INITIAL SETTING OF THE POTENTIOMETER DIALS.

THE SELECTOR SWITCH SHALL BE KEPT IN THE #2 POSITION BETWEEN READINGS. AFTER MAKING MEASUREMENTS, THE SELECTOR SWITCH SHOULD BE RETURNED TO THE RECTIFIER INSTRUMENT POSITION AND THE BATTERY SWITCH TO THE OFF POSITION.

(B) TO SET A CALIBRATION SOURCE

PROCEDURE FOR SETTING A CALIBRATION SOURCE CAN BE DESCRIBED BY AN EXAMPLE, I.E., AT 120 VOLTS.

1. CONNECT THE SOURCE AND EXTERNAL POTENTIOMETER TO THE INSTRUMENT FOR NORMAL OPERATION - SELECTOR SWITCH IN RECTIFIER INSTRUMENT POSITION.
2. SET RANGE SWITCH WHILE INSTRUMENT IS IN THIS POSITION. THIS WILL BE THE 150 VOLT RANGE (METER SHOULD READ 1.2 ON VOLTAGE SCALE).
3. SET THE PRECISION POTENTIOMETER TO 1.20000 VOLTS (100 X RANGE EQUALS 120.00 VOLTS).
4. TURN SELECTOR SWITCH TO NO. 2 TC-DC CAL POSITION.
5. CLOSE THE TEST KEY IN THE EXTERNAL POTENTIOMETER - ADJUST NO. 2 CONTROLS UNTIL NULL IS OBTAINED ON THE EXTERNAL GALVANOMETER. THIS MAKES THE VOLTAGE DROP ACROSS THE INTERNAL 200 OHM RESISTOR EQUAL TO 1.20000 VOLTS.
6. PRESS THE TEST KEY ON THE HERMACH-ENGELHARD INSTRUMENT AND ADJUST THE NO.1 CONTROLS UNTIL A NULL IS OBTAINED ON THE BUILT-IN GALVANOMETER. USE MAXIMUM SENSITIVITY FOR FINAL SETTING. THIS MAKES THE REFERENCE EMF EQUAL TO THE D-C DEVELOPED EMF OF THE THERMAL CONVERTER.
7. TURN THE SELECTOR SWITCH TO NO. 1 TC-AC AND, WHILE OPERATING THE TEST KEY IN THE HERMACH-ENGELHARD INSTRUMENT, ADJUST THE EXTERNAL SOURCE UNTIL A NULL IS OBTAINED. THIS MAKES THE A-C DEVELOPED EMF OF THE THERMAL CONVERTER EQUAL TO THE REFERENCE EMF.

THIS PROCEDURE SHOULD BE FOLLOWED FOR A FEW OPERATIONS TO MINIMIZE THE ELAPSED TIME FOR SETUP. IT IS ADVISABLE TO CHECK THE MEASUREMENT AT INTERVALS IN THE USUAL WAY. MANUAL COMPENSATION FOR SLIGHT DRIFT OF THE POWER SUPPLY CAN BE CHECKED BY MEANS OF THE STANDARD MEASURING TECHNIQUE.

"AS IN ALL PRECISION SLIDE WIRE EQUIPMENT, A CERTAIN AMOUNT OF OXIDATION CAN BE EXPECTED ON THE SLIDE WIRE WHEN NOT IN CONSTANT USE. WHEN THE HERMACH-ENGELHARD TRANSFER METER HAS NOT BEEN USED FOR A PERIOD OF TIME, AN ERRATIC OR STEP MOVEMENT OF THE GALVANOMETER INDICATOR LIGHT MAY BE ENCOUNTERED WHILE ADJUSTING THE FINE CONTROL POTENTIOMETERS. TO INSURE AGAINST THIS CONDITION WHICH IS CAUSED BY A FILM OF OXIDATION, THE FOLLOWING PROCEDURE IS RECOMMENDED:

WITH NO INPUT APPLIED TO THE METER TERMINALS, THE FINE CONTROL KNOBS SHOULD BE OSCILLATED AT LEAST ONE DOZEN TIMES IN SHORT ARCS OVER THE ENTIRE RANGE OF THE POTENTIOMETER.

## CAUTION

DUE TO THE LOW IMPEDANCE OF THE METER IN THE VOLTAGE RANGES (133 OHMS/VOLTS), IT WOULD BE ADVISABLE TO LEAVE THE METER IN THE NO. 1 POSITION DURING CALIBRATION OF THE SECONDARY METERS UNLESS A THOROUGH CHECK HAS SHOWN THAT THE RECTIFIER INSTRUMENT PUTS THE SAME LOAD ON THE SYSTEM AS THE THERMAL CONVERTER. IF THE REGULATION OF THE POWER SUPPLY IS WITHIN THE NECESSARY LIMITS, THEN THIS PRECAUTION IS NOT NECESSARY.

## ACCESSORIES

A. EXTERNAL VOLTMETER MULTIPLIER

CASED (#30501) WITH ADAPTER (#32042)

RANGES: 600 AND 1200 VOLTS

ACCURACY: ± .15%

FREQUENCY RANGE: 20 TO 10,000 CPS.

## OPERATION

BRIDGE THE ADAPTER BETWEEN THE MULTIPLIER AND VOLTMETER, INSERTING THE FOUR BANANA PLUGS INTO THE CORRESPONDING TERMINALS. (FIG. 7)

CONNECT AN A-C SOURCE TO EITHER THE 600 OR THE 1200 VOLT TERMINAL AND GROUND TERMINAL ON THE MULTIPLIER.

FOLLOW PROCEDURE OUTLINED IN OPERATION SECTION (PAGES 7 AND 9); BUT MULTIPLY THE POTENTIOMETER READING BY THE FACTOR INDICATED ON MULTIPLIER PANEL ADJACENT TO THE TERMINAL USED.

B. EXTERNAL AMMETER TRANSFORMER

#30,500 WITH CONNECTORS (#30625)

RANGES: 100, 50, 20 AND 10 AMPERES

FREQUENCY RANGE: 25 TO 2500 CPS.

EACH UNIT SUPPLIED WITH NATIONAL BUREAU OF STANDARDS TYPICAL RESPONSE CURVE AND INDIVIDUAL TRANSFORMER DATA.

## OPERATION

CONNECT TRANSFORMER TO VOLTMETER, USING LINKS (#30625) AS SHOWN IN FIGURE 8.

SOURCE IS CONNECTED TO TERMINALS CORRESPONDING TO THE A-C CURRENT TO BE MEASURED.

SET METER RANGE SWITCH AT 5 AMPERES; AND PROCEED ACCORDING TO OPERATING INSTRUCTIONS (PAGE 7).

CURRENT (IN AMPERES) IS DETERMINED BY THIS FORMULA:

$I_{A-C} = E_{POTR.} \times 10 \times$ TRANSFORMER RANGE/5 X CORR. FACTOR

$I_{A-C}$ = ALTERNATING CURRENT

$E_{POTR.}$ = POTENTIOMETER VOLTS

CORR. FACTOR = CORRECTION FACTOR - DERIVED FROM TRANSFORMER CURVES

## REPLACEMENT PARTS

| | |
|---|---|
| THERMAL CONVERTER | PART # 30,033 |
| LAMP BATTERY | 30,108 |
| MERCURY CELL PACK | 30,004 |

WHEN ORDERING SPARE PARTS, PLEASE INCLUDE SERIAL NUMBER OF THE METER.

DETERMINING WHEN REPLACEMENT PART IS NEEDED:

A. FAILURE OF THE GALVANOMETER LAMP BATTERY IS INDICATED BY DIMMING OF THE LIGHT SPOT. THE "D" SIZE INDUSTRIAL CELL IS READILY OBTAINABLE EITHER FROM CHARLES ENGELHARD, INC., OR LOCAL SOURCES.

B. THE MERCURY CELL REPLACEMENT INDICATOR IS A RAPID STEADY DRIFT WHICH PREVENTS MAKING A MEASUREMENT.

C. IF A THERMAL CONVERTER HAS BEEN OVERLOADED BUT INTACT, IT WILL BE ERRATIC AND UNSTABLE, EVEN ON A BATTERY CHECK, MAKING IT DIFFICULT OR IMPOSSIBLE TO OBTAIN A GALVANOMETER BALANCE. IF THE THERMAL CONVERTER IS NOT INTACT, THE TROUBLE WILL BE READILY DISCERNIBLE BY AN INABILITY TO BALANCE THE GALVANOMETER.

D. THE TRANSFER METER CAN BE PERIODICALLY CHECKED BY APPLYING DIRECT CURRENT TO THE INPUT. THE D-C VALUE SHOULD BE DETERMINED BY A VOLTBOX AND POTENTIOMETER ON VOLTAGE RANGES AND A STANDARD RESISTOR AND POTENTIOMETER ON CURRENT RANGES. D-C TO D-C DIFFERENCE CHECKS SHOULD BE MADE BY USING FORWARD AND REVERSE POLARITY OF THE SOURCE. THIS DIFFERENCE SHOULD BE LESS THAN .03% OF THE SCALE RANGE.

   THE D.C. MEASURING EQUIPMENT SHOULD BE CERTIFIED BY THE NATIONAL BUREAU OF STANDARDS.

## REPLACEMENT INSTRUCTIONS

1. GALVANOMETER LAMP BATTERY - REMOVE INSTRUCTION PLATE IN LOWER RIGHT HAND CORNER. REMOVE TYPE "D" DRY CELL; INSERT NEW CELL AND REPLACE COVER.

2. THERMAL CONVERTER - REMOVE INSTRUCTION PLATE, PULL OUT CONVERTER, SLIP SLEEVING BACK AND UNSOLDER 4 LEADS. SOLDER LEADS TO NEW CONVERTER, REPLACE SLEEVING AND INSERT NEW CONVERTER IN THE INSTRUMENT. REPLACE COVER.

FOLLOW COLOR CODE IN SOLDERING LEADS TO TERMINALS.

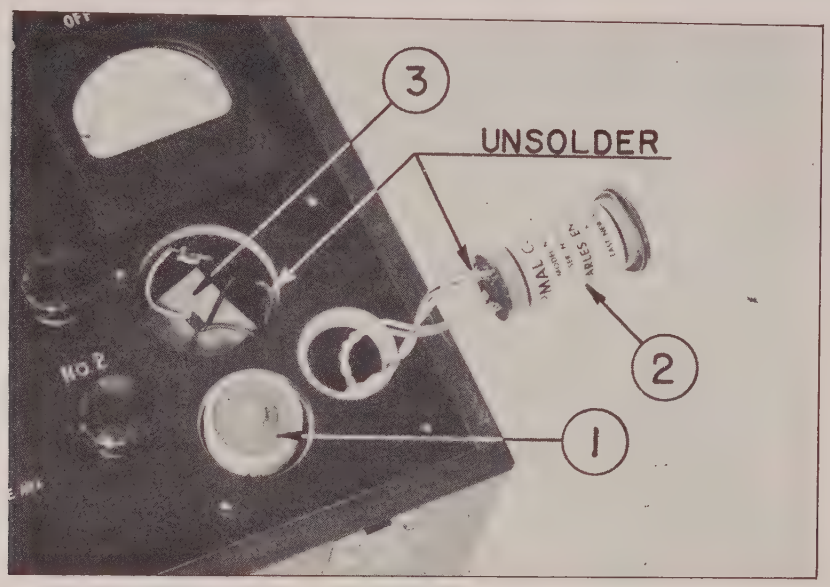


FIG. 5

3. MERCURY CELL PACK - REMOVE INSTRUCTION PLATE. UNSOLDER FOUR (4) LEADS AS SHOWN. REMOVE PACK, INSERT NEW PACK AND SOLDER LEADS TO TERMINALS (FOLLOWING COLOR CODE). REPLACE FELT BLOCK AND INSTRUCTION PLATE.

THE DRY CELL FURNISHED FOR THE GALVANOMETER LAMP IS A "LEAKPROOF" TYPE. HOWEVER, IF THE METER IS TO BE STORED OR NOT USED FOR ANY APPRECIABLE LENGTH OF TIME, IT IS ADVISABLE TO REMOVE THIS CELL FROM THE METER.

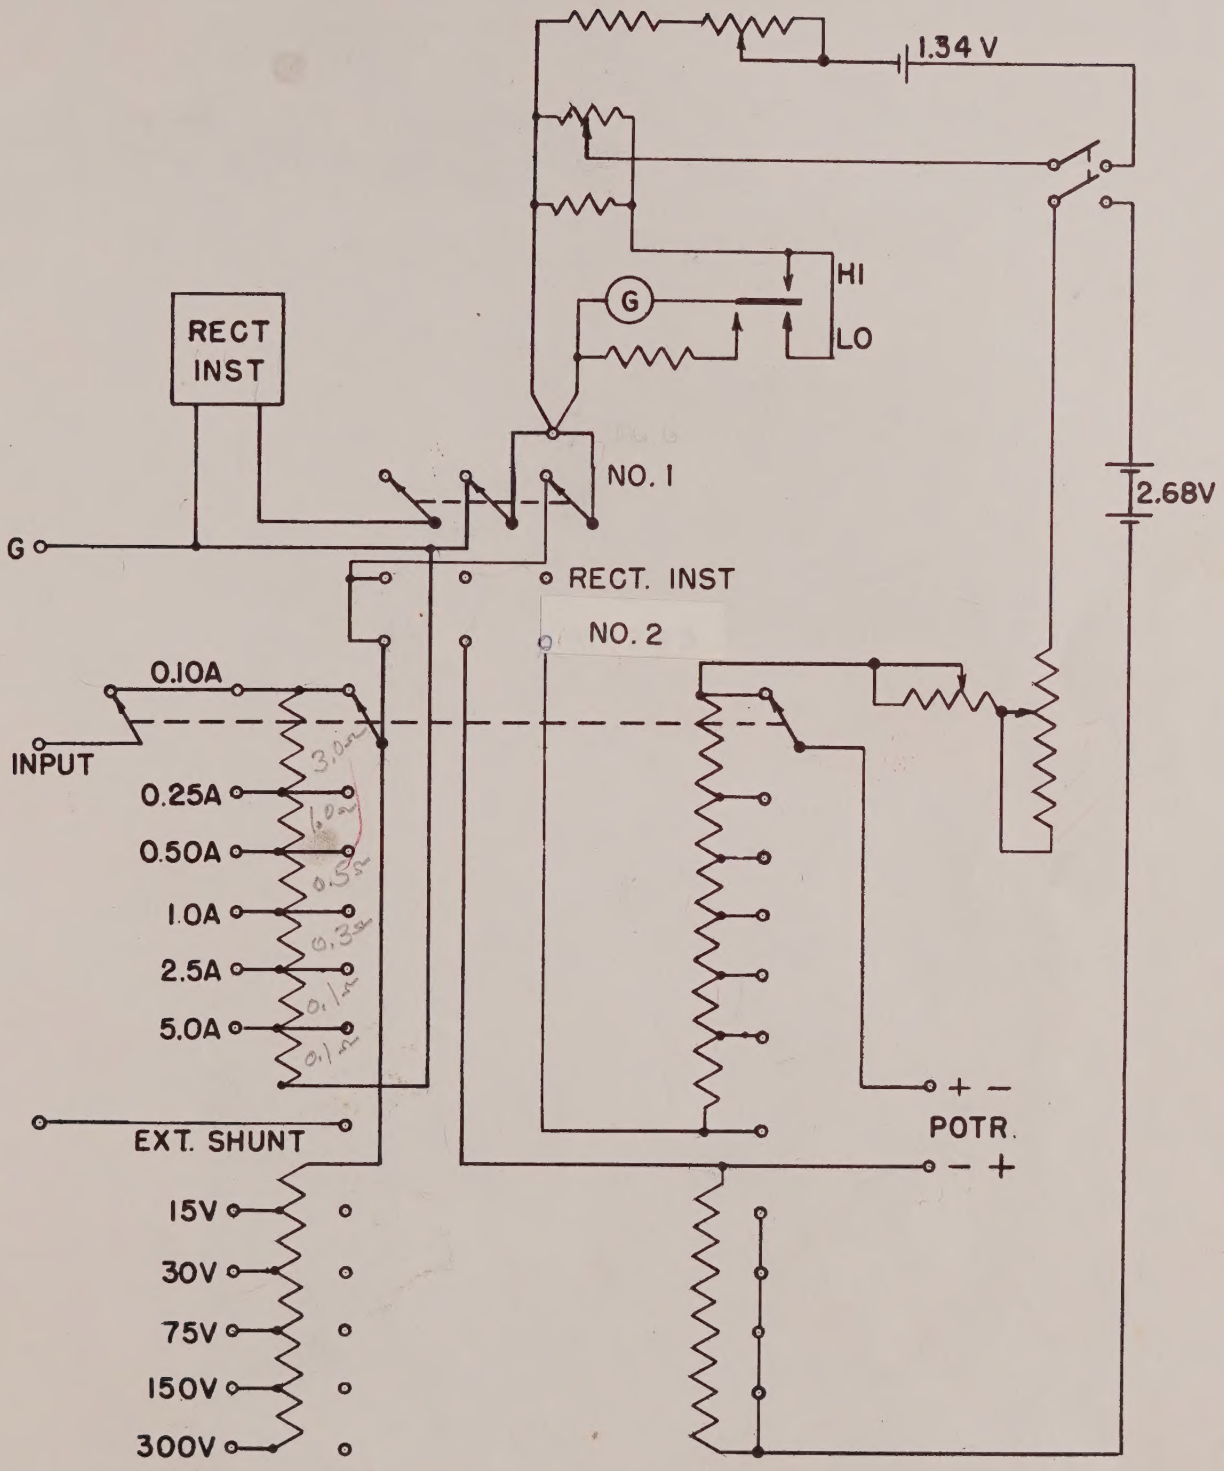


FIG. 6 BASIC SCHEMATIC DIAGRAM

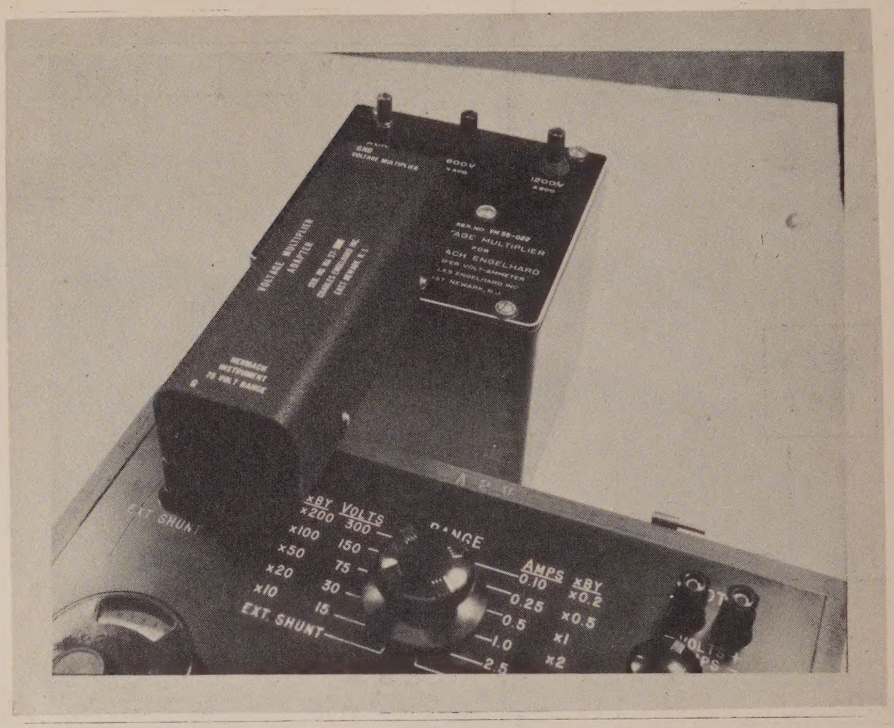


EXTERNAL VOLTAGE MULTIPLIER #30,501
FIG. 7

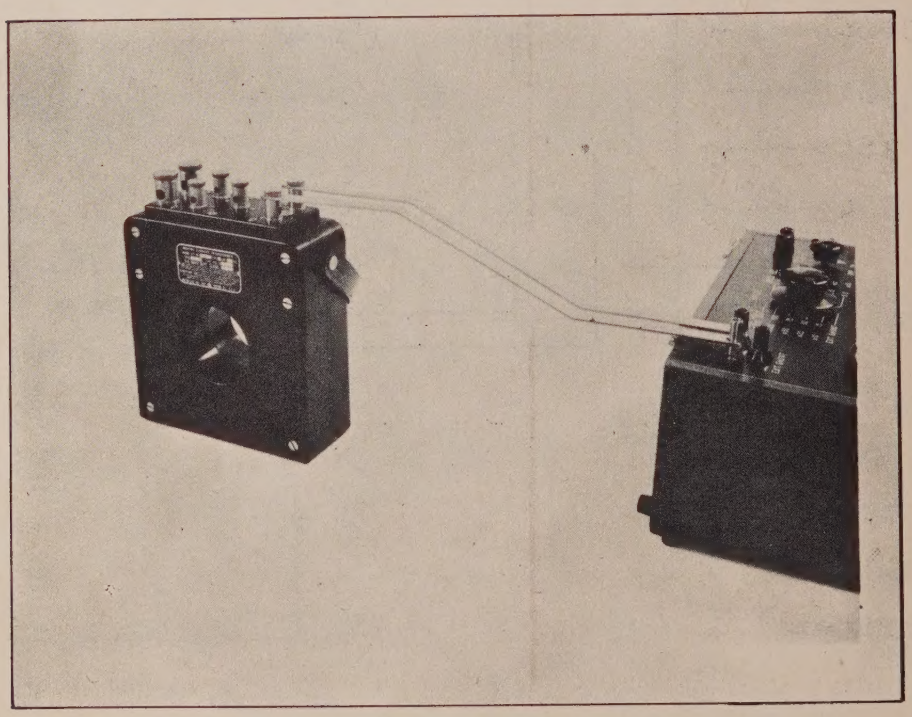

EXTERNAL AMMETER TRANSFORMER #30,500
FIG. 8